

# Daily Well History - Interim

Instructions: This form is used during drilling or workover operations. If testing, coring, or perforating, show formation name in describing work performed. Number all drill stem tests sequentially. Attach description of all cores. Work performed by Producing Section will be reported on "Interim" sheets until final completion. Report official or representative test on "Final" form. Submit "Interim" sheets when filled out but not less frequently than every 30 days, or (2) on Wednesday of the week in which oil string is set. Submit weekly for workovers and following setting of oil string until completion.

District <b>WESTERN</b>	County or Parish <b>COLUMBIA</b>	State <b>OR</b>
Field <b>MIST</b>	Lease or Unit <b>BENSON</b>	Well no. <b>14-7-64</b>

Date and depth as of 8:00 a.m. Complete record for each day while drilling or workover in progress

5-1/4  
10-13-88

TD: 1990' (735') Drill  
MW: 9.8 VIS: 44

MU locked assy. TIH to 1200'. Ream 1200'-1255'. Drill 6-1/4" hole f/ 1255'-1514'. CBU. POOH. MU 30' dropping assy. TIH. Drill 6-1/4" hole f/ 1514'-1786'. POOH. MU locked assy. TIH. Drill f/ 1786'-1990'. Top of C&W 1887' (34 u gas).

Surveys: 1359' 31°45' S42E, 1484' 33°15' S40E,  
1605' 31°15' S36E, 1730' 28°30' S35E,  
1803' 27° S34E.

6-1/4  
10-14-88

TD: 2506' (516') WOO  
MW: 9.8 VIS: 40

Drl'd & survey 6-1/4" hole f/ 1990' to 2311' w/ WT @ 2209'. POOH. LD 3 stabs. RIH w/ pendulum BHA. Drl'd f/ 2311' to 2443'. Stuck pipe making connection. Jar free. Drl'd f/ 2443' to 2506'. Circ & WT to shoe. POOH f/ logs. RU Atlas. Run DIL/SP/Sonic/Cal f/ 2506' to 1079'. WOO.  
Surveys: 2144' 26°15' S52E, 2477' 21°35' S35E, 2502' 21°15' S35E

7  
10-17-88

TD: P&A to surface

RD Atlas. RIH to 2506'. Circ. POOH LD DC's & HWDP. RU Howco. Circ w/ OEDP @ 1129'. M&P 75 sx "G" + 3% CaCl<sub>2</sub>. CIP @ 1323 10/14/88. POOH. WOC. MU 6-1/4" bit. Tag plug @ 929'. Approved by DOGMI. POOH. LD excess DP. RIH to 60' w/ OEDP. Cmt w/ 30 sx "G" + 3% CaCl<sub>2</sub>. Good returns. CIP @ 1916 hrs 10/14/88. Set out BOPE. Cut off 9-5/8" csg. Weld plate on casing. RR @ 2400 hrs 10/14/88.

The above is correct

Signature <i>P.D. Shatta</i>	Date <i>3/3/89</i>	Title <b>DISTRICT DRILLING ENGINEER</b>
---------------------------------	-----------------------	--

For form and distribution see Producing Section 10, and 97

Number all daily well history forms consecutively as they are prepared for each well.

Page no.

*343*