

Instructions: Prepare and submit the "Initial Report" on the first Wednesday after a well is spudded or workover operations are started. Daily work prior to spudding should be summarized on the form giving inclusive dates only.

District Western	County, parish or borough Columbia	State OR
Field Mist	Lessee or Unit Busch	Well no. 14-15-65
Auth. or W.O. no. API #009-00119	Title Plug & Abandon	

Section 15, Township 6 North, Range 5 West (Property Code M830016B1)

Operator ARCO OIL AND GAS COMPANY	ARCO W.O. 100%
Spudded or W.O. begun Workover	Date 11/12/90
	Hour Shut-In

Date and description of 8:00 a.m. Complete record for each day reported

11/12/90 ( 1 ) TD: 2258'	5-1/2" @ 1753' SDFN MIRU. KILL WELL. SET BPSV, ND TREE, NU BOPE, PULL BPSV. LD LANDING JT. PU TBG, TAG BTM @1697'. PULL UP T/1445'. SHUT-IN WELL, INSTALL BPSV. CMTRS TIED UP UNTIL 11/13.
11/13/90 ( 2 ) TD: 2258'	5-1/2" @ 1753' RIG RELEASED, WELL P&A'D CHK PRESS ON WELL, WELL DEAD. TH OETBG T/1646'. SET P&A PLUG F/1646-100' IN 3 STAGES. TOTAL 179 SX 'G'+3% CACL. LD TBG, ND BOPE, DIG OUT CELLAR. RELEASE RIG 1100 HRS. SQZ 39 SX 'G'+3% CACL DOWN 8-5/8" X 5-1/2" ANNULUS. FINAL PRESS 825 PSI. SHUT IN ANNULUS, SECURE WELL. WILL CUT-OFF WELLHEAD 11/14/90.
11/14/90 ( 3 ) TD: 2258'	5-1/2" @ 1753' P&A COMPLETE BLEED PRESS OFF 8-5/8" X 5-1/2" ANNULUS. CUT OFF WELLHEAD. SET 10' SURFACE PLUG IN ANNULUS & IN 5-1/2". WELD CAP ON STUB.

*Handwritten notes:*  
 The above is correct.  
 Name: [unclear]  
 Signature: [unclear]

The above is correct:		
Signature <i>H. L. Vally</i>	Date 11/17/91	Title DISTRICT DRILLING ENGINEER

For form preparation and distribution, see Procedures Manual, Section 10, Drilling, Pages 66 and 67.

Number all daily well history forms consecutively as they are prepared for each well:	Page no. 1 of 1
---	--------------------