

STATE OF OREGON
DEPARTMENT OF GEOLOGY AND MINERAL INDUSTRIES

800 NE Oregon St #28 Portland, OR 97201

HISTORY OF OIL OR GAS WELL
(In compliance with rules and regulations pursuant to ORS 520)

Enerfin Resources Northwest	"Cavenham Forest Industries"	23-15-54
(Company or Operator)	(Lease)	(Well No.)
Sec. <u>15</u> T <u>5N</u> R <u>4W</u>	Surveyed Coordinates:	
SHL= <u>841.09' South and 1,799.72' East of West 1/4 corner</u>		
BHL= <u>410.18' South and 305.86' East of SHL</u>		
Wildcat: <u>NA</u>	(or) Field Name: <u>Mist Gas</u>	County: <u>Columbia</u>
Signature: 		
Date: <u>September 22, 1998</u>	Position: <u>Consultant</u>	

Use this form in reporting the daily operations at the well. (Operator may use his own forms, but heading of this form must also be completed and submitted.) Please submit a complete history of the well. Include such information as bit sizes, mud weights, casing sizes and depths set, amount of cement used, drilling depths, fishing, logging, perforating, and plugging procedures, and anything else pertinent to the operations. Do not include lithology.

Date

- July 27, 1998 MIRU Taylor Rig #1. Unload cementing equipment and cement, and rig up.
- July 28, 1998 Open well. Attempt to bleed pressure off well (would not bleed off). Fill well with lease water. Remove tree and install BOPE. Pull hangar and lower tubing to 2,380'. Mix and pump 25 sx (5 BBLs) of Class "G" cement (calculated TOC at 2,121'). Pull out of hole. Secure rig and CWIFN.
- July 29, 1998 Open well. Run in hole and locate TOC at 2,112' (witnessed and approved by Dan Wermiel-DOGAMI). Change hole over to drilling mud. Pull out of hole laying down tubing. Nipple down BOPE. Rig down and move equipment off location.
- July 30, 1998 Cut off wellhead and cut casings 5' below ground level. Set 25' cement plug in 5-1/2" casing and 5-1/2" X 9-5/8" annulus. Restore location.